NISSAN NORTH AMERICA, INC.
Copyright ©

SERVICE BULLETIN

Classification:	Reference:	Date:
EC09-025	NTB09-129	November 17, 2009

VENT CONTROL VALVE REPLACEMENT

APPLIED VEHICLES: All Nissan models using Vent Control Valve P/Ns 14935-AM60A / AM60B

SERVICE INFORMATION

When replacing the EVAP canister vent control valve for any reason:

- Use the one listed in the **PARTS INFORMATION** section of this bulletin on Page 2.
- For vent control valve replacement procedure, refer to the appropriate section of the Electronic Service Manual (ESM) if needed.
- When installing the new valve, do not add any lube to its o-ring.
- For Frontier (D40 series) only: install the protector listed in **PARTS INFORMATION**.
  - For protector installation, see the **SERVICE PROCEDURE** section of this bulletin starting on Page 3.
- Make sure to use the **"new style"** valve listed in **PARTS INFORMATION**.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

PARTS INFORMATION

DESCRIPTION	P/N	QUANTITY
Valve Assy - Control (New Style)	14935-JF00A	1
Protector	17559-ZZ00A	1
Clip (Tie Straps)	24216-S5800	2

Old style vent control valve
P/N 14935-AM60B

<u>New style</u> vent control valve
P/N 14935-JF00A

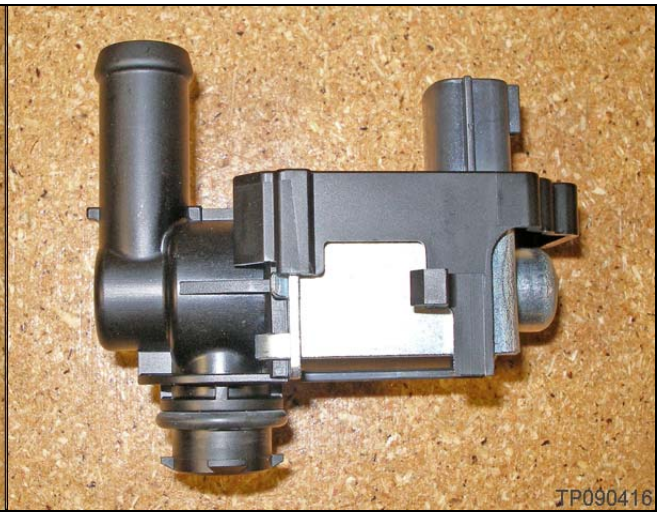

CLAIMS INFORMATION

Submit a Primary Failed Part (PP) line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Rpl Evap Canister Vent Control Valve	(1)	FC50AA	ZE	32	(2)

(1) Reference the Parts Information table above and use the Valve Assy - Vent Control P/N as the PFP (Primary Failed Part).
(2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated FRT (Flat Rate Time).

<u>Also on the same repair line Frontier (D40 Series)</u>:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Install Protector	(1)	EX25AA	ZE	32	0.2

SERVICE PROCEDURE

Frontier (D40 series) only: Install Protector

Viewed from under vehicle

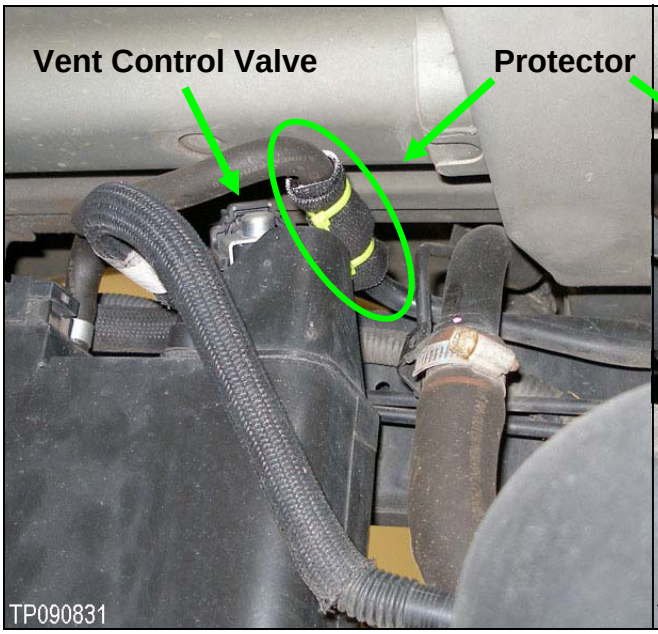

Figure 1

Viewed from left rear wheel well

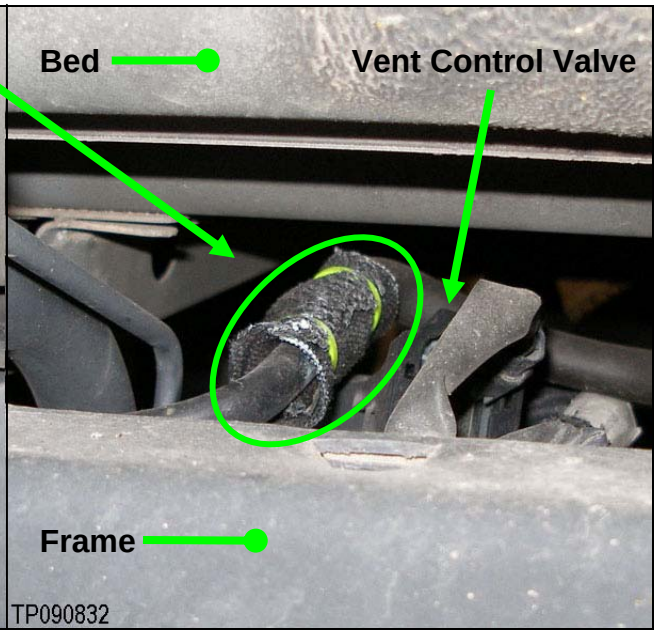

Figure 2

1. Wrap the protector around the EVAP hose (see Figure 1 and 2).
    - Locate the protector between the hose and the vent control valve.
2. Secure the protector with two tie straps.